FRÍANT

DUAL MONITOR ARM INSTALLATION
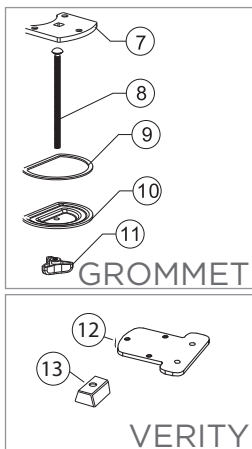
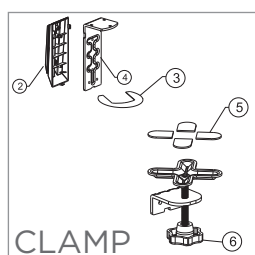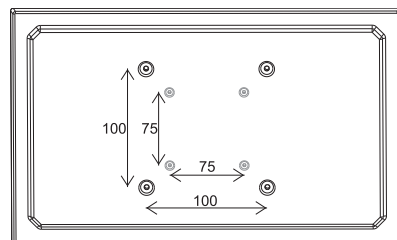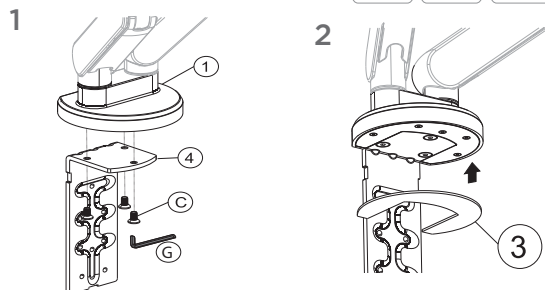| A x4	B x4	C x3	D x2	F x8	G x1	H x1
M4x12mm	M5x12mm	M6x12mm	M6x10mm		4X4	5X5

Parts:
1. Dual monitor arm (1)
2. cable cover (1)
3. anti-slip rubber *clamp* (1)
4. bottom support *clamp* (1)
5. anti-slip rubber *clamp* (4)
6. knob (1)
7. bottom support *grommet* (1)
8. screw (1)
9. anti-slip rubber *grommet* (2)
10. pressure plate (1)
11. knob nut (1)
12. bottom support *verity* (1)
13. block *verity* (2)

GROMMET

CLAMP

VERITY

Step 1:
Make sure there are VESA holes (100 x 100mm or 75 x 75mm). Then, remove the original fixed base of the monitor. Make sure you are careful not to scratch the monitor screen. Accommodates screen size 10" - 30", monitor weight 4.4 - 19.8 lbs.
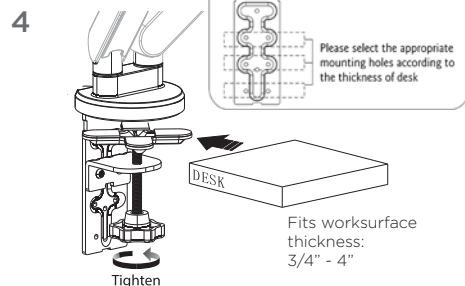
100   75
75
100

Step 2A: Clamp Option

C x3	D x2	G x1
		4X4

1
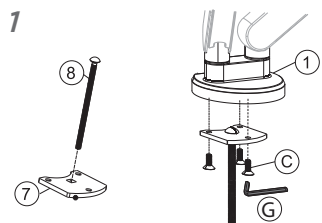Use the 4x4 allen wrench to attach to bottom support *clamp* with M6x 12mm screws (3).

2
Attach anti-slip rubber *clamp* to the bottom of the monitor arm.

3
Using the 4x4 allen wrench, attach the knob to the bottom support using M6x 10mm (2) screws. Place anti-slip rubber on top of the installed knob.
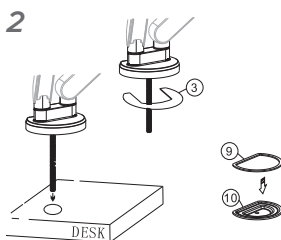
4
NOTE
Please select the appropriate mounting holes according to the thickness of desk

Tighten

Fits worksurface thickness: 3/4" - 4"

Insert desktop in the gap between the monitor arm and the bottom support. Place the cable cover over exposed cables.

Step 2B: Grommet Option

C x3	G x1
	4X4

1
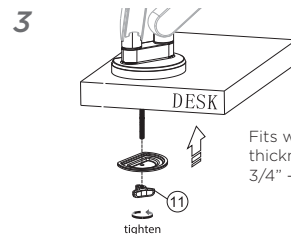Insert screw into bottom support *grommet*. Use the 4x4 allen wrench to attach bottom support *grommet* to monitor arm by using M6x 16mm screws (3).
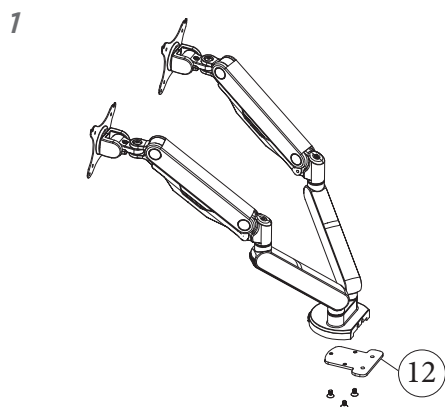
2
Attach monitor arm to desk, by inserting the base with the screw into the pre-drilled hole. Before you merge your monitor arm and your desk, make sure you are using the anti-slip rubber *grommet*.
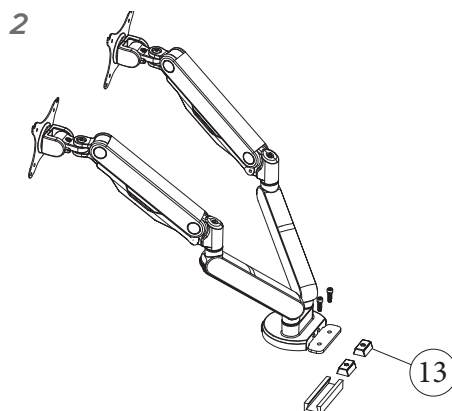
3
Fits worksurface thickness: 3/4" - 4"

tighten

Attach anti-slip rubber *grommets (2)* to the pressure plate. Attach the pressure plate to the bottom of the worksurface by screwing everything together with the knob nut.
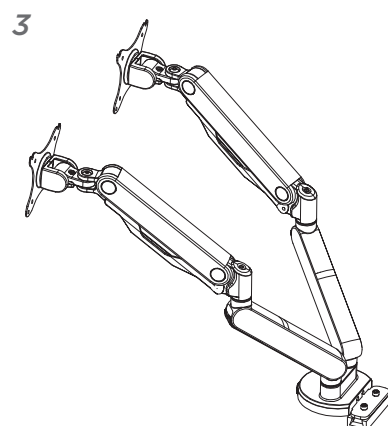
Step 2C: Verity Track

1

Attach the bottom support *verity* to the monitor arm with screws (3).
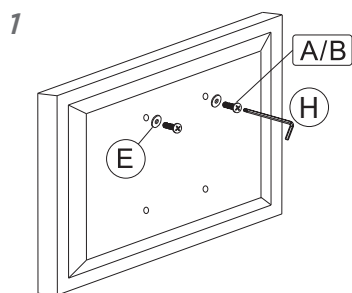
2

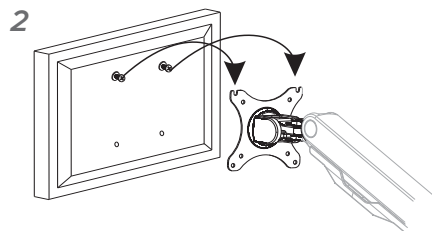Insert the blocks (2) into the Verity track. Then, using screws, attach the monitor arm bottom support to the blocks (2).
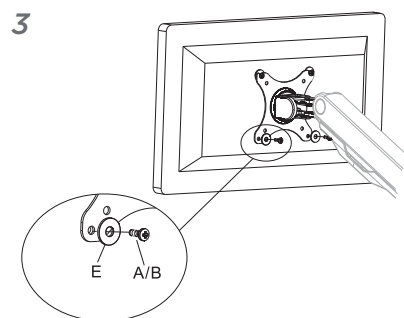
3

Final installation shown.

Step 3: Install monitor to plate (2)

1

A/B
H
E

Using M4x 12 mm or M5x 12mm screws, screw into the top holes on the back of the monitor.

2

Position monitor by aligning screws with grooves in the upper corners of the monitor attachment bracket.

3

E   A/B

Using the bolts (2) and M4x 12mm (2) or M5x 12mm (2) to secure the monitor to the monitor arm.

Step 4: Adjust the monitor

Adjust the monitor's height after installing. If the monitor is not at your desired height, use the 5x5 allen key to adjust the screw on the arm.

In order to make the weight of the mount and the monitor arm equal (so it can stop at any height), adjust the screws accordingly: "-" direction in order to move the monitor up and "+" direction to move the monitor down.

±180°
±180°
-85°~15°
-85°~15°
±90°
H
±180°
±180°
H
DESK
2